



Sensigas°

Gas detectors Carbon dioxide (CO₂)

IP55 protection rating

URD20SL



11...28Vdc power supply.

Nondispersive infrared (NDIR) sensor designed for the detection of carbon dioxide (CO_2) .

Up to three alarm thresholds plus sensing element fail.

LED on sensing element body to indicate operating status.

Automatic countdown of sensor life.

Use

The URD20SL detectors are used to detect the presence of carbon dioxide (CO₂), in non-classified areas.

It detects carbon dioxide leaks or emissions in industrial environments, hospitals, fermentation plants, greenhouses, stables and, more in general, where carbon dioxide is stored, generated or produced.

URD20SL sensors can be used in stand-alone mode with 4...20mA output or with an optional voltage-free contact relay card having the following four digital outputs:

Pre-alarm, 1st alarm threshold, 2nd alarm threshold, sensor fail.

Operation

If there is a gas leakage, the detector compares the measured concentration value with the threshold limit setpoints and energises the associated relays. Information on the measured concentration value is always at the 4...20mA output.

Ordering

To order, simply state the part number: **URD20SL**.

For special versions, on request, please contact Customer Service.

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	1/8

Technical characteristics Type of sensor **Detectable Gas**

Power supply Max power consumption

Measuring range

Precision \pm 5% full scale, \pm 10% readout Repeatability \pm 5% full scale, \pm 10% readout

NDIR (nondispersive infrared)

by jumper selectable polarity

Carbon dioxide (CO₂)

11÷28Vdc

0...20,000 ppm

3.2W

Measurement resolution 20 ppm

Microprocessor resolution 1024 points (10 bit) Digital filter system Kalman Filter Watchdog Internal

Warm-up time < 2m Stabilization time < 2m Response time < 25s (T90) Average Sensor life (in air) 255 weeks

4..20mA Output

Proportional mode -4mA = 0 ppm-20mA = 20000 ppm(default) Consumption mode - 0mA = no alarm

- 10mA = 1st threshold alarm - 20mA = 2nd threshold alarm (applications at 1 or 2 thresholds)

4...20mA Output reference selection:

4...20mA output load resistor - up to 200Ω at 12Vdc power supply

- $200\Omega \div 700\Omega$ at 24Vdc power supply

-20 ÷ 50 °C Operating Temperature Storage Temperature -20 ÷ 70 °C

Relative Humidity (without condensing)

15 ÷ 90 %RH - Operation - Storage 45 ÷ 75 %RH

Operating pressure (KPa) $80 \div 110$ Air speed (m/s) ≤ 6

Visual warnings Red LED visible with detector energised See dedicated section

Dimensions and weight Options & Accessories

Card with 4 SPDT relays UZR20.4 See threshold limit settings

NO or NC contacts available,

jumper selectable

50mA at 24Vac/dc, 100mA at 12Vac/dc Maximum relay capacity: Relay operating mode: direct: relay ON when an event is detected

reverse: relay ON when no event is

detected TUL40.. Gas calibration kit See installation and commissioning chapter TUS40 Handheld terminal See installation and commissioning chapter for service and maintenance

CRG40 Gas collecting cone See dedicated data sheet **PAP40** Powerful jets protection See dedicated data sheet

EC Conformity

EMC Directives / Standards Electromagnetic Compatibility Directive EMC 2004/108/EC, Standard EN50270

LVD Directives / Standards Not applicable

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	2/8

Sensors lifetime

Sensor average lifetime (see technical characteristics) is referred to a typical usage in a pollution-free environment. Presence of a high concentration of pollutants can shorten the lifetime of the sensing element.

Once the detection system starts up, it has to be supplied with energy during all the lifetime of its sensors.

Seasonal use of the detection system is not recommended.

Installation

The relative density of carbon dioxide is about one and a half times that of air, so it tends to collect at floor level in closed, unventilated environments.

Therefore, the sensor must be installed about 30 cm above the floor level.

Take into consideration the following specific installation guidelines, as well as the above instructions, for location of the detectors.

The detectors must be installed:

- 1. where accidental gas leakages are possible
- 2. at least 1.5m away from heat sources or from vent holes
- 3. not in spaces where ventilation is poor and where gas pockets may form
- 4. away from hindrances to natural gas flow
- 5. away from equipment that may leak gas during normal operations
- 6. in environments with a temperature range of -20°C to 50°C and relative humidity below 90% (non-condensing)
- 7. Disconnect equipment from the power supply when mounting and dismantling detectors.

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	3/8

Electrical Installation


<u>CAUTION:</u> Make the area safe and make sure that the device power supply is off before cabling and configuration operations.

Install the sensor in compliance with laws in force.

The cable gland provided on the housing is used for cable entry.

Ground the sensor using the internal grounding system.

Terminal board and electrical connections

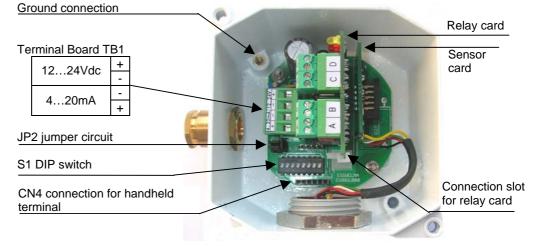

Cabling:

Depending on the connecting distance, use at least 3-core cable, min diameter 0.75mm^2 up to 100mm^2 , 1mm^2 up to 200mm^2 , 1.5mm^2 up to 500mm^2 .

Use shielded cable where there is a risk of electromagnetic interference.


If a relay card is used, use multi-core cable suitable for the number of connections.

Configuration:

Default settings of the sensor are shown in the "Technical Specifications" chapter. In order to change the default settings, switch off the power supply, input the new settings at the JP2 jumper circuit or at the S1 DIP switch as shown in the diagram, then power-up again; in particular:

4...20mA Output reference selection:

The default setting for the 4-20mA signal is the negative power signal. Output reference selection should be made by JP2 triple of jumpers; to change this setting, operator has to move **JP2** jumpers as shown in the figure:

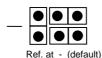



<u>Caution:</u> if the default settings are changed, the connections on the **TB1** terminal board will be inverted.

4...20mA signal operating mode configuration:

To set the operating mode of the 4...20mA signal, it is necessary to use the 5th selector of the DIP switch at **S1**; in particular:





10, 15, 25%

25, 35, 50%


10, 15, 30%

20, 40, 60%

Setting threshold limit values:

(*) When the first four selectors of the DIP switch are in OFF position, the threshold limit values can only be set by the TUS40 handheld terminal. If this is selected without using the handheld terminal, the detector will automatically set the default threshold To set the detector values. with the handheld terminal, see the dedicated instruction manual.

To set the threshold limit values of the optional relay card, or of the threshold operating mode of the 4...20mA signal, it is necessary to use the first four selectors of the DIP switch at **S1**; in particular, the thresholds, given in full scale percentage, will be:

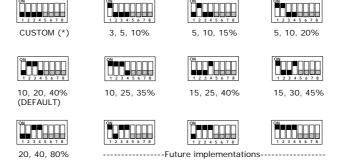

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	4/8

Mechanical installation of the optional relay card

The control card can be expanded with a relay card inserted into a dedicated connector **CN3** with four SPDT relays that will be activated under the following conditions: pre-alarm, 1st threshold alarm 2nd threshold alarm and sensor fail, and relative LED alerts.


To install the card, follow the instructions below:

Step 1:

Insert the connection slot provided with the relay card into the control card, making sure the flexible tab is towards the main terminal board. Find CN3 connector.

CN3 connector


Connection slot (flexible tab)

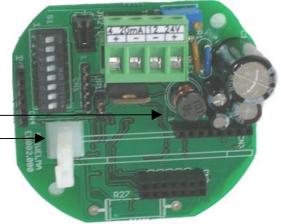

Step 2:

Fit the relay card snugly and pull the flexible tab of the connection slot towards the main terminal board.

Flexible tab

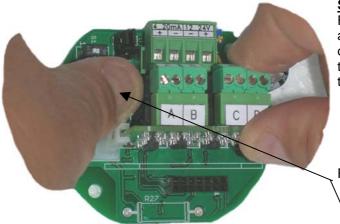

Step 3:

Check the position of the card. Make sure that all the card pins fit into the CN3 connector and push slightly upwards to check that the flexible tab on the connection slot keeps the card in place.









TYPE URD20SL Vmax: 28 Vdc Pmax: 3,2 W

12V 100mA (24V 50mA)

-20 ≤ Ta ≤ +50 °C

Step 4:

Tick the check box with a permanent marker to indicate the presence of the relay card in the device

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	5/8

Electrical installation of the optional relay card

Selecting the type of contact on the terminal board:


After mechanically installing the relay card, it is necessary to configure it electrically, selecting the relay operating mode and the type of contact desired on the terminal board (NC or NO).

A pair of extractable terminals is available for each relay; the type of contact (NC or NO) to be associated with them can be selected using the **JP1...JP4** jumpers.

NC or NO contact of pre-alarm relay NC or NO contact of 1nd THRESHOLD relay NC or NO contact of 2nd THRESHOLD relay NC or NO contact of FAIL relay DL1 (yellow), Sensor FAIL D В DL2 (red), 2nd alarm THRESHOLD DL3 DL3 (red), 1st alarm THRESHOLD **₽**DL⁴ DL4 (red), Pre-alarm Selecting the terminal contact: -11-EW082.010

Configuring the relay operating mode:

To set the operating mode of the relays: for direct (relay energised by event) or reverse (relay energised with no event), it is necessary to use the 6th selector of the DIP switch at **S1**; in particular:

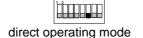



Checklist after mechanical and electrical installation

The sensors are factory calibrated so they normally do not require any other calibration once installed. Still, after installation, an operational check of the sensors is recommended.

The detector will enter a 2-minute warm-up phase after power-up.

After this time, the sensor will switch to normal operating mode, but it will take about 2 hours before it reaches top performance level.

When the detector is operating, a gas response check should be carried out using the **TUL40..** gas calibration kit. This kit contains:

- 2 calibration gas cylinder: 1 x 5000ppm of CO₂; 1 x Pure Nitrogen (see kit part numbers on the specific technical data sheet)
- pressure valve and flow regulator
- sensor body adapter
- about 2 metres of hose between cylinder and adapter.

During the test, check the output current, the status of the LED outside the enclosure on the sensor body and, if present, the status of the LEDs on the relay card before closing the housing.

The LED on the sensor body and the 4...20mA output have the following operating meaning:

Sensor status	420mA Output	Status LED on sensor body	
WARM-UP	2mA Flashing at 2Hz frequency		
OPERATING	420mA 1 flash about every 10 sec.		
PRE-ALARM	0,10,20mA for 2 flashes about every 5 sec.		
1 st ALARM THRESHOLD	threshold	hold 3 flashes about every 5 sec.	
2 nd ALARM THRESHOLD	applications	4 flashes about every 5 sec.	
SENSOR FAIL	22mA	Steady	

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	6/8

Checklist after mechanical and electrical installation (continued)

Use the calibration kit to apply the gas mixture at 5000ppm of CO_2 , making sure that the 4...20mA output is between 7 and 9mA (theoretic value 8mA), and that the status LED and the pre-alarm, 1^{st} and 2^{nd} alarm threshold on the optional relay card switch on according to the threshold settings.

Use the Pure Nitrogen gas cylinder to check the zero calibration.

Maintenance

A sensor functional test should be carried out every three-six months.

Routine

Routine maintenance involves repeating the same tests as set forth in "checklist after mechanical and electrical installation".

Corrective

If any abnormalities are found during routine sensor maintenance, return the sensor concerned to the supplier / installer, who in turn will send it back to the manufacturer.

Sensors may need to be re-calibrated, using the **TUL40.** gas calibration kit and the **TUS40** handheld terminal, which must be connected to the sensor via the communication interface integrated in the cable (on the connector **CN4**).

For the re-calibration procedure, see the instructions supplied with the handheld terminal.

Decommissioning

Remove power from the detector, disconnect all wiring and conduits and dismount the housing from all the blocking systems.

Warranty

Warranty on EsiWelma products is valid for 12 months from installation date and no longer than 24 months from manufacturing date on the product. Installation data, stamp and signature on the data sheet filled in by the installer will be considered proof for warranty.


A copy of the warranty data sheet must be sent when returning the product under warranty.


Accessories


UZR20.4 Four-relay card TUL40.. Gas calibration Kit TUS40 Handheld terminal CRG40 Gas collecting cone PAP40 Powerful jets protection

Dimensions and weight

Dimensions (HxWxD): 130x100x60mm.

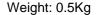

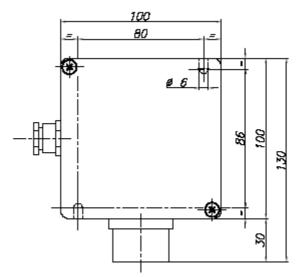

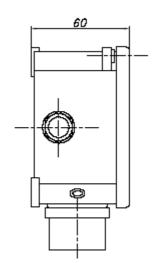

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	7/8

Installation data	To be	To be filled in by Installer		
	Installation site:	Installation site:		
	Product order number	:	\dashv	
	Part Number:	Manufacturing date:		
	Installation date:	Replacement date:	\dashv	
Routine checks				
	I o be filled in by	Installer / Service Personnel	Signature	
Remarks				
-				

EsiWelma Srl	URD20SL_en.doc - rev. 0	CO ₂ gas detectors – URD20SL
24/09/2010	Gas detection systems for industrial environments	8/8